


CS-3

TYPE MOLDS

*Angular Cable Drop to Vertical Steel Surface
For AWG Conductors*

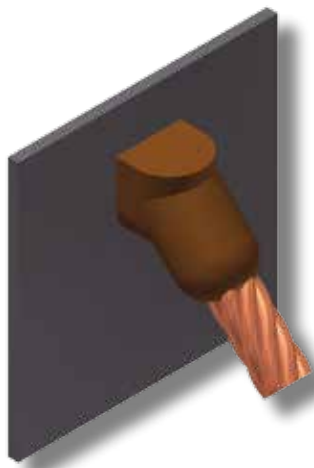

MOLDS FOR AWG CONDUCTORS										
Cable Size	STANDARD CONNECTION					HEAVY DUTY CONNECTION				
	Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time	Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
#6	M-585	4	45	B-106	2	M-585-H	4	65	B-106	2
#4	M-586	4	45	B-106	2	M-586-H	4	65	B-106	2
#2	M-588	4	45	B-106	SDS	M-588-H	4	90	B-106	2
#1	M-589	4	65	B-106	2	M-589-H	4	115	B-106	2
1/0	M-590	4	90	B-106	SDS	M-590-H	4	150	B-106	2
2/0	M-591	4	90	B-106	SDS	M-591-H	4	150	B-106	2
3/0	M-592	4	115	B-106	2	M-592-H	4	200	B-106	4
4/0	M-593	4	115	B-106	SDS	M-593-H	4	200	B-106	2
250 MCM	M-594	4	115	B-106	2	M-594-H	4	200	B-106	2
300 MCM	M-595	4	150	B-106	2	M-595-H	4	250	B-106	4
350 MCM	M-596	4	200	B-106	2	M-596-H	4	250	B-106	4
500 MCM	M-598	4	200	B-106	2	M-598-H	5	2-150	B-107	2
750 MCM	M-599	5	2-150	B-107	2	M-599-H	5	500	B-107	4
1000 MCM	M-600	5	2-200	B-107	2	M-600-H	5	3-200	B-107	4

- **For sizes not listed, contact thermOweld®.**
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For molds with wear plates, see page 135.
- For expedited service, contact thermOweld®.
- To order weld metal for use with EZ Lite Remote® insert TW before and EZ after weld metal number.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles)
 - 38-0309-00 ~ Flint Ignitor or 38-EZLT-RU EZ Lite Remote®
- Other recommended accessories;
 - 40-0106-32 ~ Vertical Chain Clamp w/ B-106 Handles
 - 40-0107-32 ~ Vertical Chain Clamp w/ B-107 Handles
 - 40-4431-00 ~ Magnetic Handle Clamp w/ B-106 Handles
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0101-00 ~ Rasp